

LOC I-AGS 110.5	APP CRS 352°	Rwy Ldg TDZE Apt Elev 8001 137 146	ILS or LOC RWY 35 AUGUSTA RGNL AT BUSH FLD (AGS)
---------------------------	------------------------	--	---

When local altimeter setting not received, use Daniel Fld altimeter setting and increase S-ILS 35 DA to 392; increase all MDAs 60 feet and S-LOC 35 and Circling Cats C and D visibility ¼ SM. Autopilot coupled approach NA below 940.

MALSR

MISSED APPROACH:

Climb to 600 then climbing left turn to 2100 direct IRQ VORTAC and hold.

ATIS 132.75	AUGUSTA APP CON★ 126.8 270.3	AUGUSTA TOWER★ 118.7 (CTAF) 239.3	GND CON 121.9 348.6	UNICOM 122.95
-----------------------	--	---	-------------------------------	-------------------------

MISSED APCH FIX

R-341

COLLIERS

IRQ

113.9

Chan 86

ALTERNATE MISSED APCH FIX

BUSHE AG

233


COLLIERS

113.9 IRQ

Chan 86

LOCALIZER 110.5

I-AGS

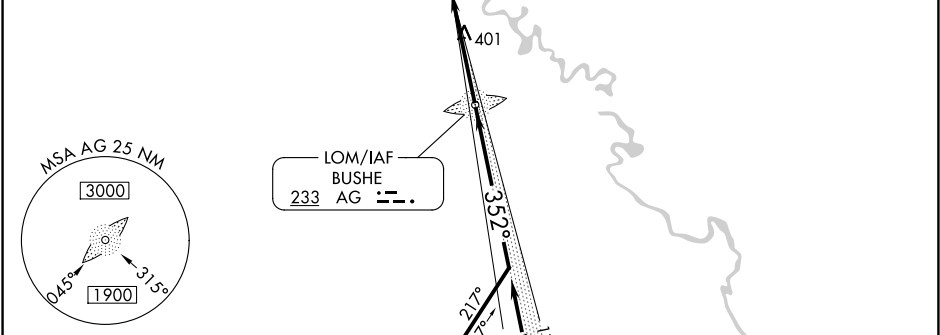

ELEV 146

TDZE 137

MIRL Rwy 8-26

HIRL Rwy 17-35

REIL Rwys 8 and 26

TWR

8001 X 150

6001 X 100

35

352°

FAF to MAP 4.5 NM

Knots	60	90	120	150	180
Min:Sec	4:30	3:00	2:15	1:48	1:30

600 2100 IRQ				
AG LOM 1648 172° 2000 352° 1700				
VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 72).				
4.5 NM				
CATEGORY	A	B	C	D
S-ILS 35	337/24 200 (200-½)			
S-LOC 35	660/24	523 (600-½)	660/55	523 (600-1)
CIRCLING	780-1	634 (700-1)	780-1¾ 634 (700-1¾)	940-2½ 794 (800-2½)