

NW-1, 01 OCT 2026 to 29 OCT 2026

(TMBRS.TMBRS4) 26078


TMBRS FOUR ARRIVAL (RNAV) Arrival Routes

AL-330 (FAA)

PORTLAND INTL (PDX)
PORTLAND, OREGON

RNAV 1 - DME/DME/IRU or GPS.
From CITYY: RNAV 1-GPS.
RADAR required.

PORTLAND APP CON
124.35 299.2
D-ATIS
128.35 269.9
GND CON
121.9 348.6
PORTLAND TOWER
118.7 257.8 (10L-28R)
123.775 251.125 (3-21, 10R-28L)

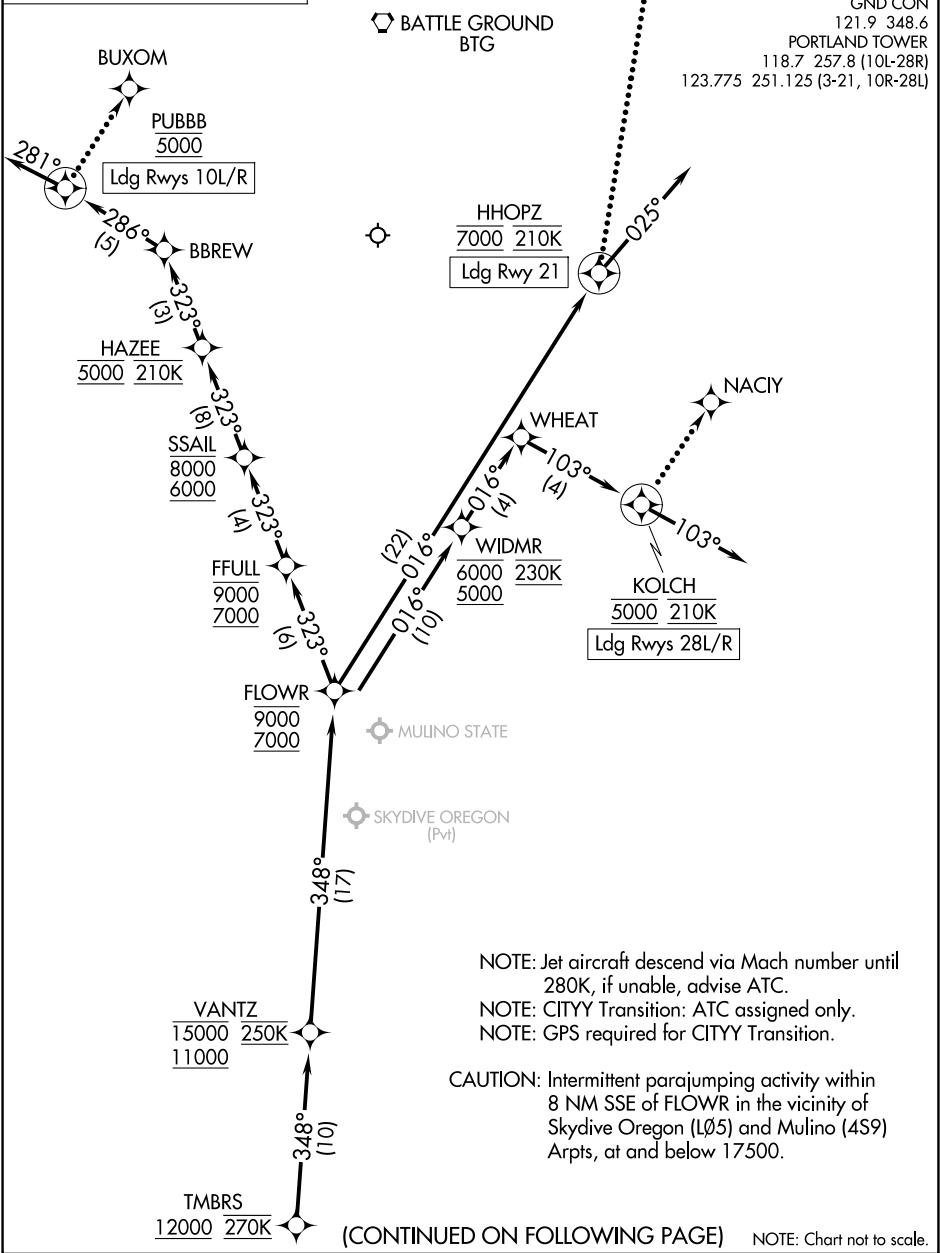

NW-1, 01 OCT 2026 to 29 OCT 2026

NW-1, 01 OCT 2026 to 29 OCT 2026

TMBRS FOUR ARRIVAL (RNAV) Arrival Routes

(TMBRS.TMBRS4) 19MAR26

PORTLAND, OREGON
PORTLAND INTL (PDX)

ARRIVAL ROUTE DESCRIPTION

From TMBRS on track 348° to cross VANTZ between 11000 and 15000 and at 250K, then on track 348° to cross FLOWR between 7000 and 9000.

LANDING RUNWAYS 10L/R: From FLOWR on track 323° to cross FFULL between 7000 and 9000, then on track 323° to cross SSAIL between 6000 and 8000, then on track 323° to cross HAZEE at 5000 and at 210K, then on track 323° to BBREW, then on track 286° to cross PUBBB at 5000, then on track 281°. Expect RADAR vectors to final approach course.

LANDING RUNWAY 21: From FLOWR on track 016° to cross HHOPZ at 7000 and at 210K, then on track 025°. Expect RADAR vectors to final approach course.

LANDING RUNWAYS 28L/R: From FLOWR on track 016° to cross WIDMR between 5000 and 6000 and at 230K, then on track 016° to WHEAT, then on track 103° to cross KOLCH at 5000 and at 210K, then on track 103°. Expect RADAR vectors to final approach course.

LOST COMMUNICATIONS

Follow published crossing altitudes and then maintain lowest rwy transition altitude until established on approach procedure.

RUNWAYS 10L/R: After PUBBB, turn right to BUXOM and proceed on the ILS or LOC RWY 10L approach.

RUNWAY 21: After HHOPZ, turn left to CREAK and proceed on the LOC/DME RWY 21 approach.

RUNWAYS 28L/R: After KOLCH, turn left to NACIY and proceed on the ILS or LOC RWY 28R approach.

NW-1, 01 OCT 2026 to 29 OCT 2026

NW-1, 01 OCT 2026 to 29 OCT 2026