


WAAS CH 50244 W31A	APP CRS 300°	Rwy Ldg TDZE 429 Apt Elev 476
--	------------------------	---

RNAV (GPS) Z RWY 31L

PALM SPRINGS INTL (PSP)

RNP APCH-GPS.		MISSED APPROACH: Climb to 900 then climbing right turn to 4000 direct TANFY and track 107° to BANPE and track 144° to TRM VORTAC and hold. *Missed approach requires minimum climb of 355 feet per NM to 2100.	
Circling NA southwest of Rwy 13R-31L.			
ATIS 124.65	SOCAL APP CON 126.7 370.95 135.275 251.1	PALM SPRINGS TOWER * 119.7 (CTAF) 377.05	GND CON 121.9
		UNICOM 122.95	

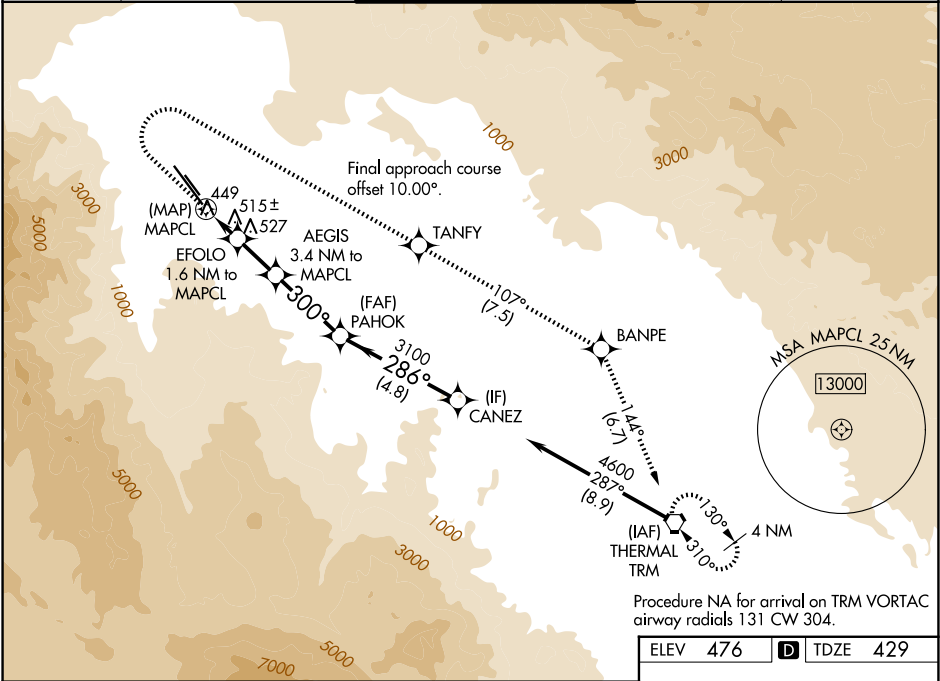

Procedure NA for arrival on TRM VORTAC
airway radials 131 CW 304.

ELEV 476	TDZE 429
----------	----------

900 4000 TANFY tr 107° BANPE tr 144° TRM		CANEZ	
VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 55).		PAHOK	
MAPCL 1220 1920		3100 4600	
0.5 1.6 NM 1.9 NM 3.2 NM 4.8 NM			
CATEGORY	A	B	C D
LP MDA	700-1 271 (300-1)	780-1 351 (400-1)	1320-2½ 891 (900-2½)
RNAV MDA*	780-1 351 (400-1)		
RNAV MDA	920-1 491 (500-1)	1180-1¼ 751 (800-1¼)	1440-3 1011 (1000-3)
CIRCLING	920-1 444 (500-1)	1180-1¼ 704 (800-1¼)	1440-3 1760-3 964 (1000-3) 1284 (1300-3)

