
GNDLF THREE ARRIVAL (RNAV) Transition Routes

HARTSFIELD/JACKSON ATLANTA INTL (ATL)
ATLANTA, GEORGIA

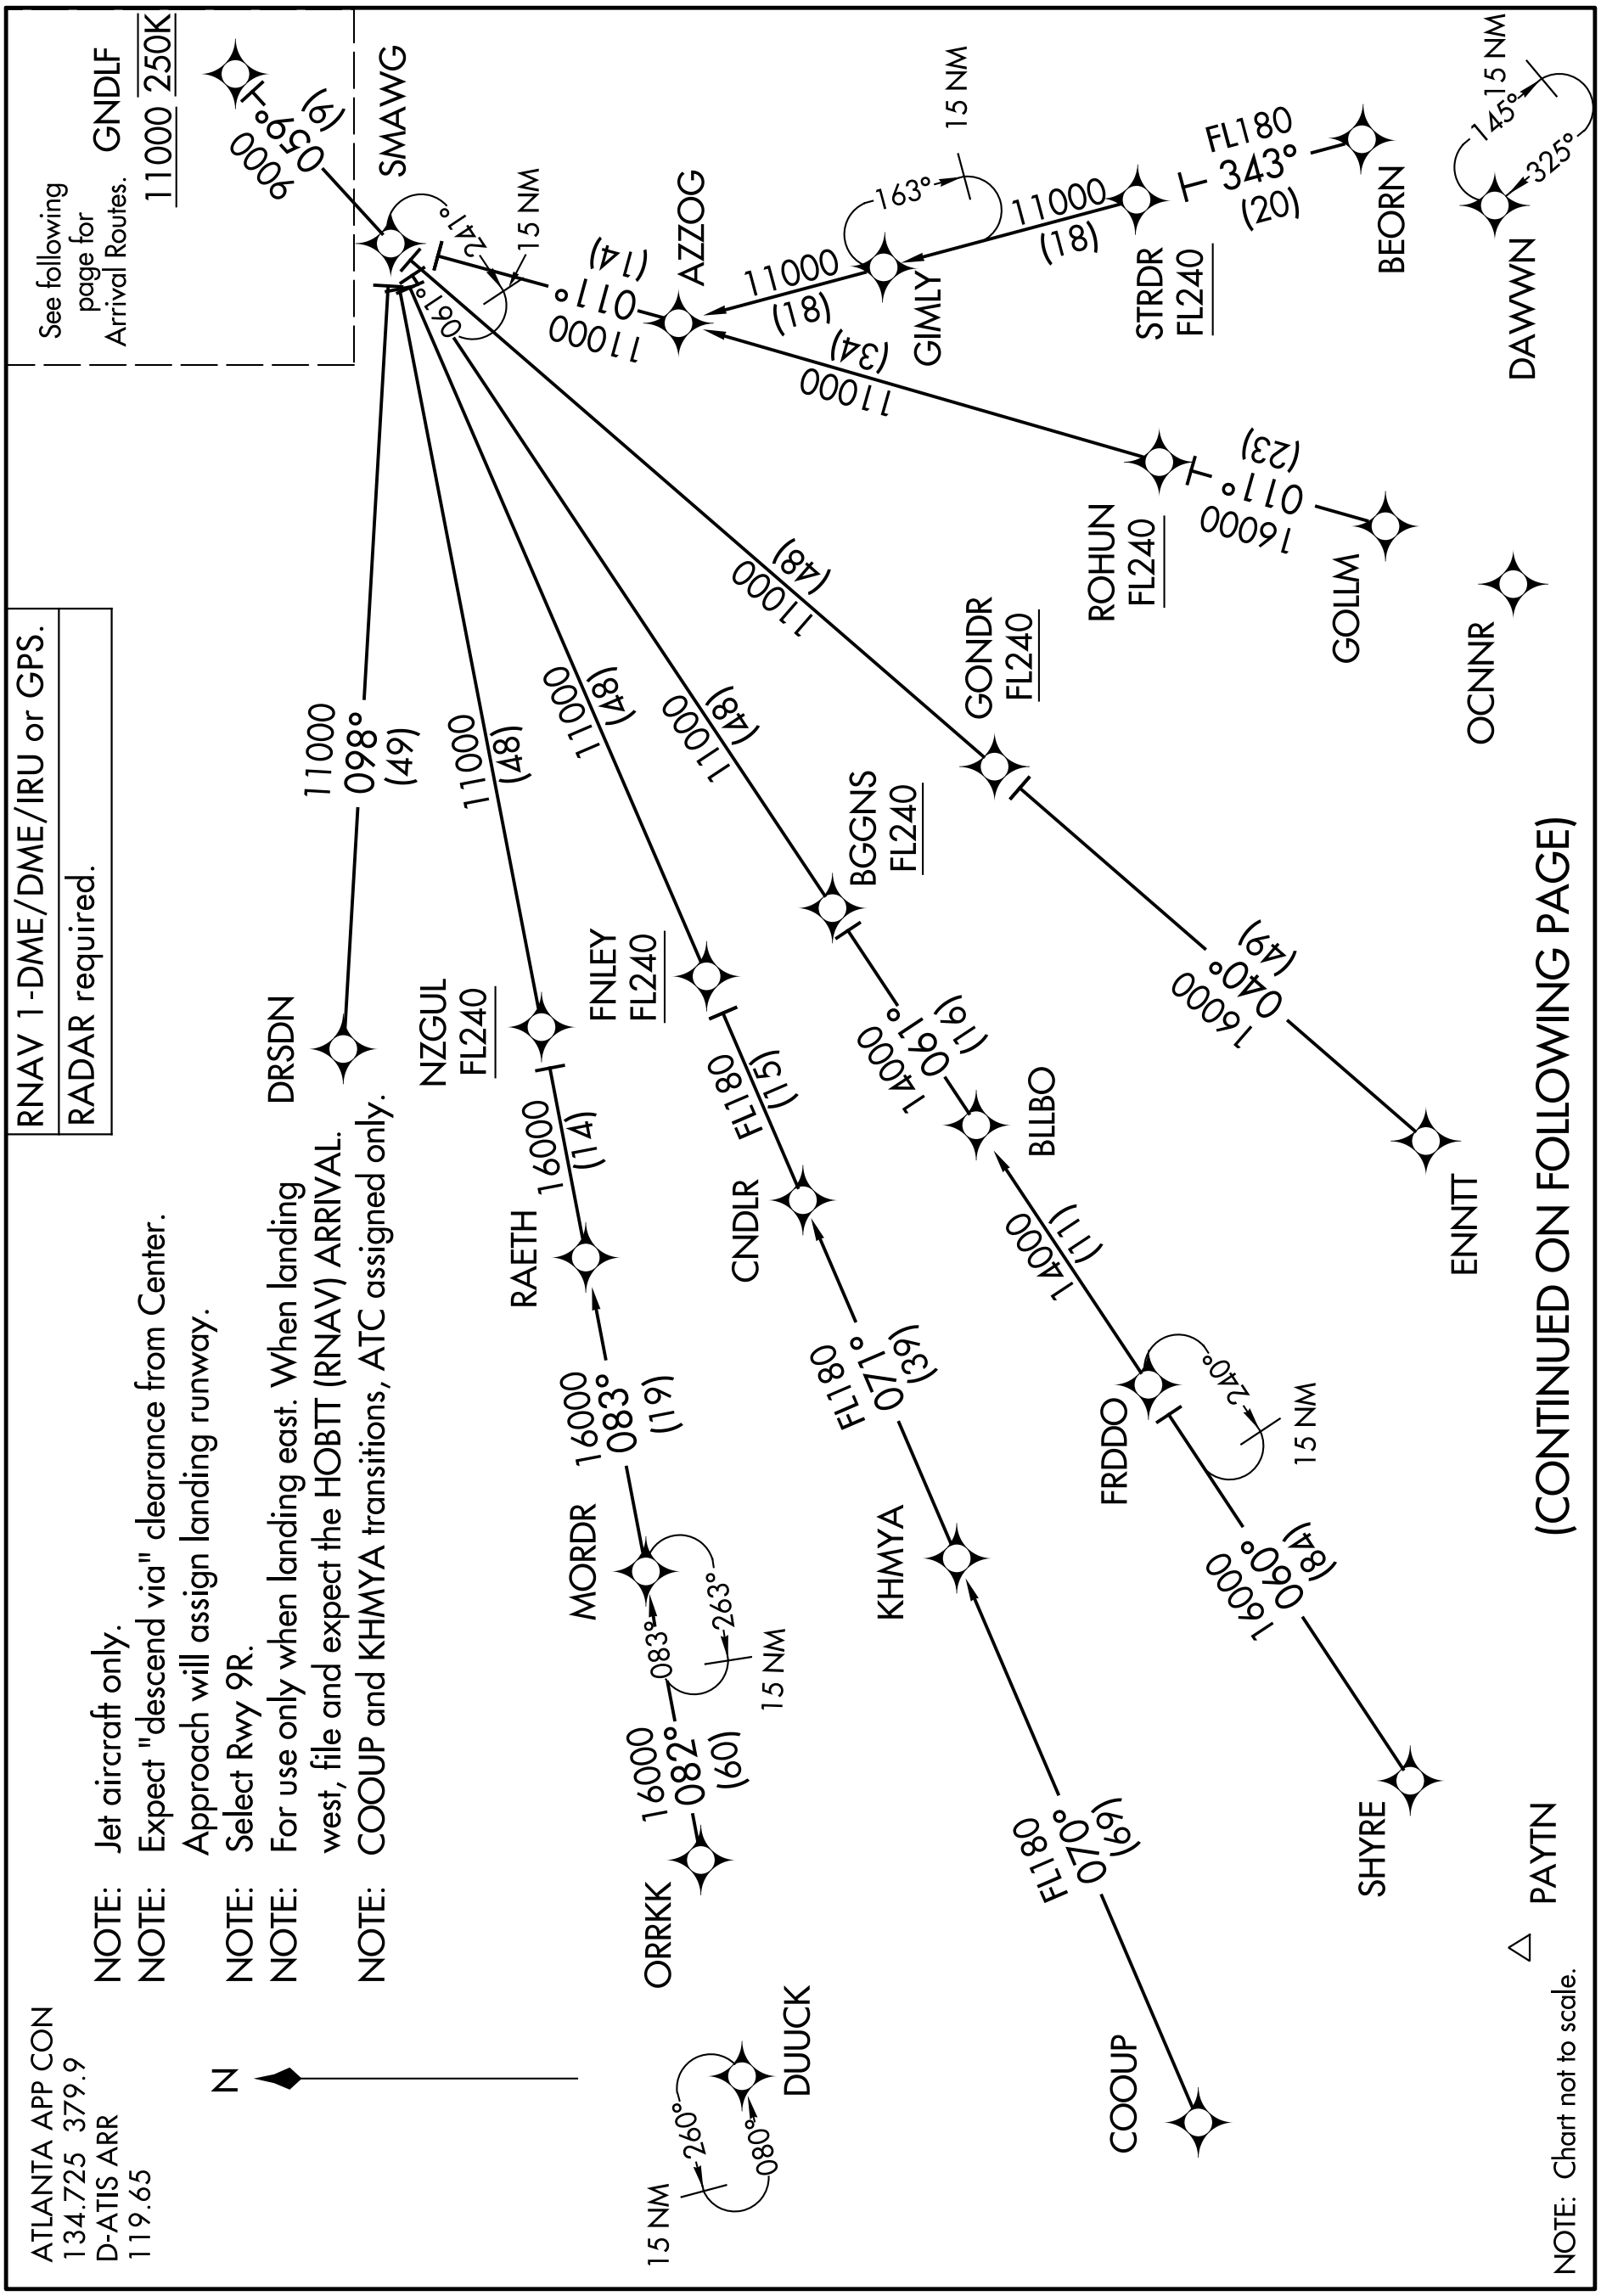

ARRIVAL ROUTE DESCRIPTION

BEORN TRANSITION (BEORN.GNDLF3)
COOUP TRANSITION (COOUP.GNDLF3)
DRSDN TRANSITION (DRSDN.GNDLF3)
ENNTT TRANSITION (ENNTT.GNDLF3)
FRDDO TRANSITION (FRDDO.GNDLF3)
GOLLM TRANSITION (GOLLM.GNDLF3)
KHMYA TRANSITION (KHMYA.GNDLF3)
ORRKK TRANSITION (ORRKK.GNDLF3)
SHYRE TRANSITION (SHYRE.GNDLF3)
STRDR TRANSITION (STRDR.GNDLF3)

From GNDLF on track 059° to cross HALRR at or above 10000 and at 250K, then on track 059° to cross SHULR at 8000, then on track 036° to JNGLE, then on track 005° to QUBIT, then on track 005°. Expect RADAR vectors to final approach course.

LOST COMMUNICATIONS:
ASSIGNED RUNWAY 10 or RUNWAY NOT ASSIGNED: Cross HALRR at or above 10000; cross SHULR at 8000; cross QUBIT at 6000; after QUBIT descend to 3000 and proceed direct DEWHY; proceed on the ILS or RNAV Rwy 10 approach.
ASSIGNED RUNWAY 9L: Cross HALRR at or above 10000; cross SHULR at 8000; cross QUBIT at 6000; after QUBIT proceed direct RYENN and proceed on the ILS or RNAV Rwy 9L approach.
ASSIGNED RUNWAY 9R: Cross HALRR at or above 10000; cross SHULR at 8000; cross QUBIT at 6000; after QUBIT proceed direct ANDIY and proceed on the ILS or RNAV Rwy 9R approach.
ASSIGNED RUNWAY 8L: Cross HALRR at or above 10000; cross SHULR at 8000; cross QUBIT at 6000; after QUBIT proceed direct LARII and proceed on the ILS or RNAV Rwy 8L approach.
ASSIGNED RUNWAY 8R: Cross HALRR at or above 10000; cross SHULR at 8000; cross QUBIT at 6000; after QUBIT proceed direct GPEAT and proceed on the ILS or RNAV Rwy 8R approach.

RNAV 1-DME/DME/IRU or GPS.
RADAR required.