


APP CRS	Rwy Ldg	5801
079°	TDZE	727
	Apt Elev	778

RNAV (RNP) Y RWY 8
HOLLYWOOD BURBANK (BUR)

RNP AR APCH.	MALSR	MISSED APPROACH: Climb to 1200 then climbing right turn to 4600 direct COTSI and on track 263° to YOLYY and hold. *Missed approach requires minimum climb of 340 feet per NM to 2400. # Missed approach requires minimum climb of 317 feet per NM to 2400.
▼ ▲ For uncompensated Baro-VNAV systems, procedure NA below 1°C or above 54°C. Straight-in Rwy 8 at night, operational VGSI required, remain on or above VGSI glidepath until threshold. Inop table does not apply to RNP 0.20 * and RNP 0.30. For inop ALS, increase RNP 0.30 # all Cats visibility to 1¼ SM.	AS	

D-ATIS 134.5	SOCAL APP CON 120.4 360.6 (N) 134.2 338.2 (W)	BURBANK TOWER 118.7 254.3	GND CON 123.9 348.6
------------------------	---	-------------------------------------	-------------------------------

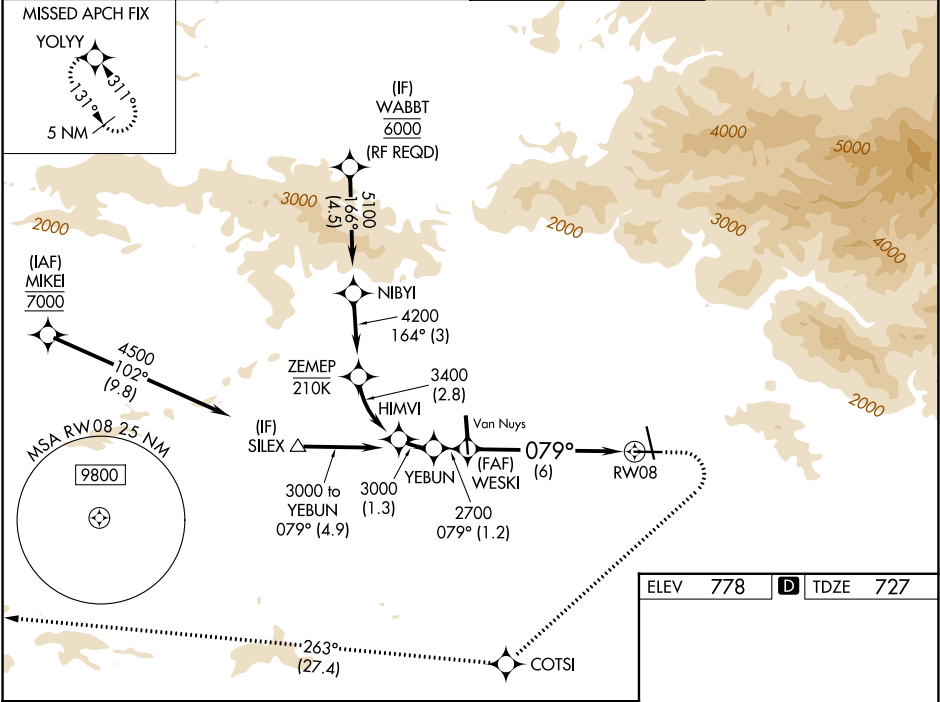

	ELEV 778	D	TDZE 727
	YEBUN	WESKI	RWY 08
	3000	2700	
	079°	2700	
	GP 3.00° TCH 60		
	1.2 NM	6 NM	
CATEGORY	A	B	C
RNP 0.20 DA*		1068/50	341 (300-1)
RNP 0.30 DA#		1151/50	424 (400-1)
RNP 0.30 DA		1485-2½	758 (800-2½)
AUTHORIZATION REQUIRED			

See planview for multiple IF locations.

1200 4600 COTSI tr 263° YOLYY

51 4 6886 X 150 1.26 UP TWR 5802 X 150 0.5% UP 20 33

079°

MIRL Rwy 15-33
HIRL Rwy 8-26
REIL Rws 15, 26 and 33