


WAAS CH 50244 W31A	APP CRS 300°	Rwy Ldg TDZE 429 Apt Elev 476
--	------------------------	---

RNAV (GPS) Z RWY 31L

PALM SPRINGS INTL (PSP)

RNP APCH-GPS.		MISSED APPROACH: Climb to 900 then climbing right turn to 4000 direct TANFY and track 107° to BANPE and track 144° to TRM VORTAC and hold. *Missed approach requires minimum climb of 355 feet per NM to 2100.		
Circling NA southwest of Rwy 13R-31L.				
ATIS 124.65	SOCAL APP CON 126.7 370.95 135.275 251.1	PALM SPRINGS TOWER * 119.7 (CTAF) 377.05	GND CON 121.9	UNICOM 122.95

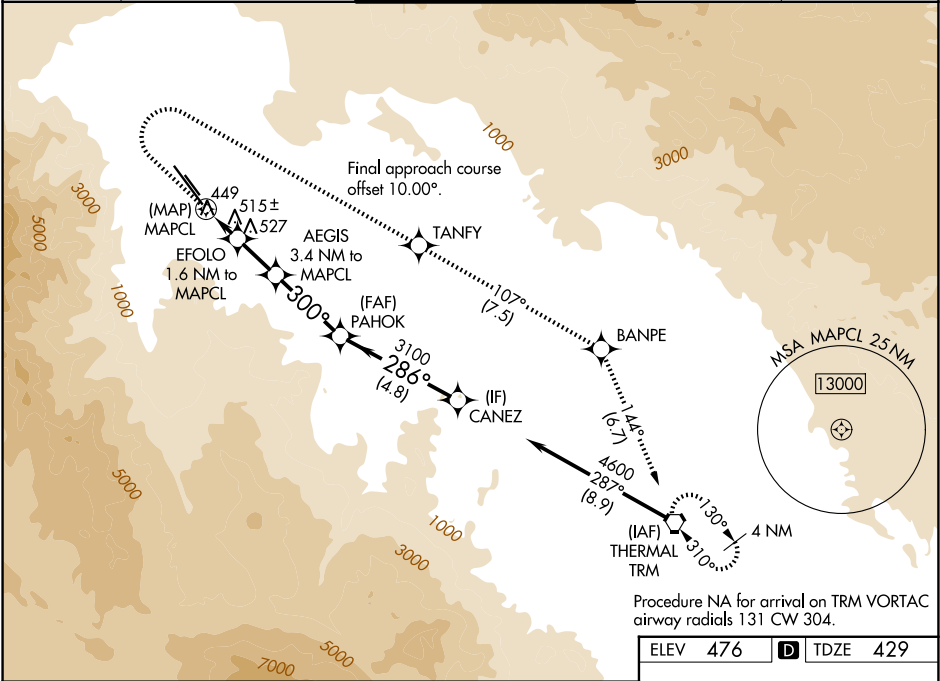

900 ↑	4000 ↗	TANFY ✧	tr 107°	BANPE ✧	tr 144°	TRM ◡	
VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 55).						PAHOK	
<p>MAPCL 1220 1920 3100 4600</p> <p>0.5 1.6 NM 1.9 NM 3.2 NM 4.8 NM</p>							
CATEGORY		A		B		C	D
LP	MDA	700-1 271 (300-1)		780-1 351 (400-1)		1320-2½	891 (900-2½)
LNAV MDA*		780-1 351 (400-1)					
LNAV MDA		920-1 491 (500-1)		1180-1¼ 751 (800-1¼)		1440-3	1011 (1000-3)
CIRCLING		920-1 444 (500-1)		1180-1¼ 704 (800-1¼)		1440-3 964 (1000-3)	1760-3 1284 (1300-3)

ELEV 476	TDZE 429
RNAV (GPS) Z RWY 31L	
HIRL Rwy 13R-31L	
MIRL Rwy 13L-31R	
REIL Rwy 13R and 31L	
REIL Rwy 13L and 31R	