RNAV (RNP) Z RWY 34C

SEATTLE-TACOMA INTL (SEA)

APP CRS	Rwy Ldg	9426
344°	TDZE	387
	Apt Elev	432

RNP AR APCH.


For uncompensated Baro-VNAV systems, procedure NA below -6°C or above 54°C. Simultaneous approach authorized except arrivals at SHIPZ. Use of FD or AP required during simultaneous operations.


MALSR

MISSED APPROACH: Climb to 5000 on track 344° to MGNUM and hold, continue climb-in-hold to 5000.

D-ATIS	SEATTLE APP CON	SEATTLE TOWER	GND CON
118.0	133.65 273.45	119.9 239.3 (16L, 16C, 34C, 34R) 120.95 239.3 (16R, 34L)	121.7

MISSED APCH FIX

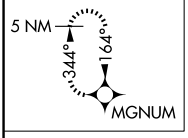

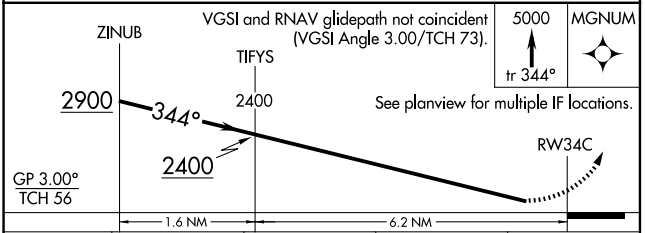


CATEGORY	A	B	C	D
RNP 0.30 DA	829/50 442 (400-1)			

AUTHORIZATION REQUIRED

ELEV 432 D TDZE 387

HIRL all rwys

TDZL/RCLS Rwys 16L, 16C, 16R and 34R

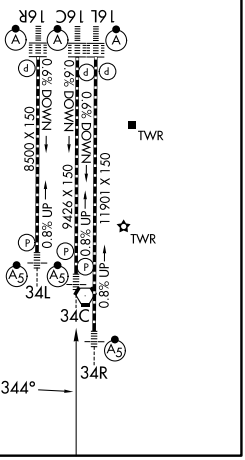

NW-1, 29 OCT 2026 to 26 NOV 2026
NW-1, 29 OCT 2026 to 26 NOV 2026