

LOC I-POC 110.5	APP CRS 259°	Rwy Ldg TDZE Apt Elev 4151 1005 1014	ILS RWY 26L BRACKETT FLD (POC)
---------------------------	------------------------	--	--


- ▼

Rwy 26L helicopter visibility reduction below ¾ SM NA.

▲

When local altimeter setting not received, use Ontario Intl altimeter setting and increase DA to 1364.
- MISSED APPROACH: Climb to 2100 then climbing left turn to 4000 on POM VORTAC R-164 to PRADO INT/POM 9.3 DME.

ATIS 124.4	SOCAL APP CON 125.5 349.0	BRACKETT TOWER★ 118.2 (CTAF) (8R/26L) 133.3 (8L/26R)	GND CON 125.0	UNICOM 122.95
----------------------	-------------------------------------	--	-------------------------	-------------------------

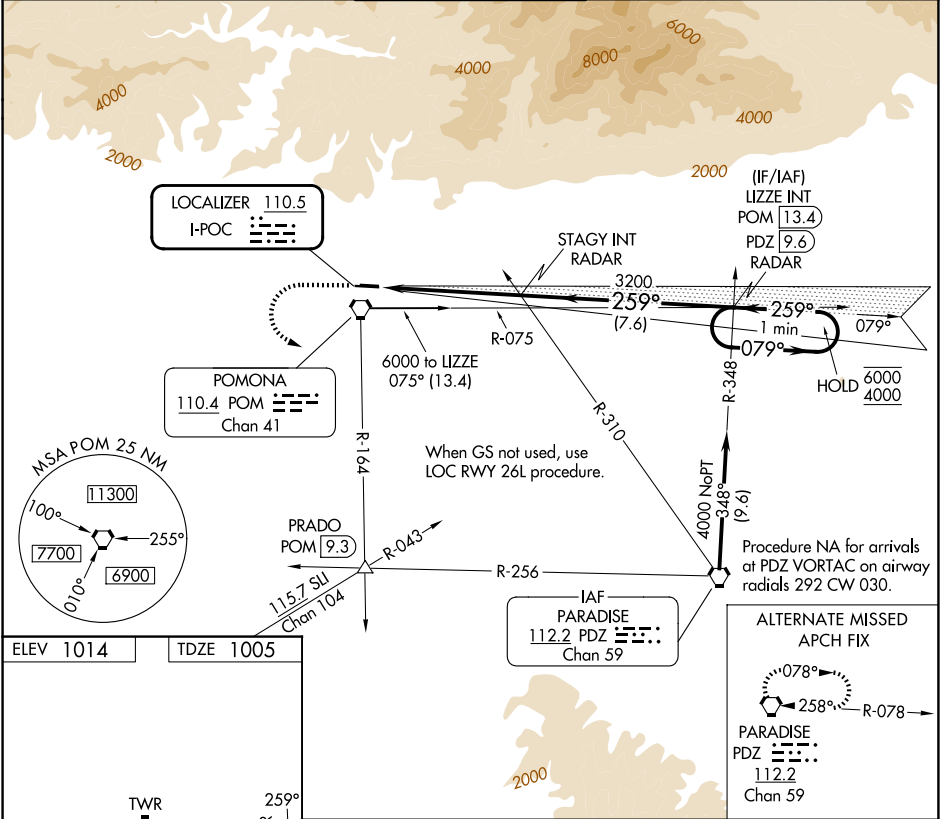

ELEV 1014 TDZE 1005		TWR 1.0% UP 3661 X 75 0.9% UP 4840 X 75		2100 4000 PRADO POM R-164	VGSI and ILS glidepath not coincident (VGSI Angle 3.76/TCH 18).	LIZZE INT PDZ 9.6 RADAR	One Minute Holding Pattern
REIL Rwy 8R and 26L MIRL Rwy 8R-26L		STAGY INT RADAR 3200 259° 079° 6000 4000 *at DTHR; 60 at Rwy end. GS 3.92° *TCH 20		CATEGORY A B C D			
S-ILS 26L		1332-1 327 (400-1)		NA			