
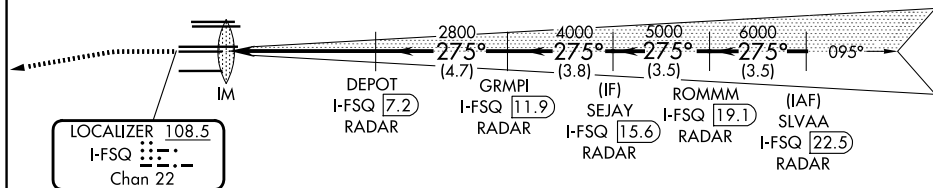
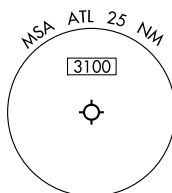


HARTSFIELD/JACKSON ATLANTA INTL (ATL)


MISSED APPROACH: Climb to 1500 then climbing left turn to 4000 on heading 265° and RMG VORTAC R-165 to DUTIE/RMG 31.3 DME/RADAR and hold.

T Simultaneous approach authorized. Use of FD or AP required during simultaneous operations. Dual VHF comm required. See additional requirements on AAUP.


CLNC DEL 118.1	CPDLC
-----------------------------	-------

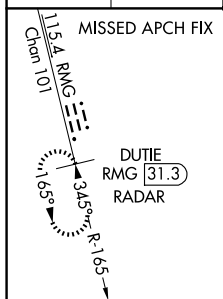

ELEV	1026	D	TDZE	999
------	------	----------	------	-----

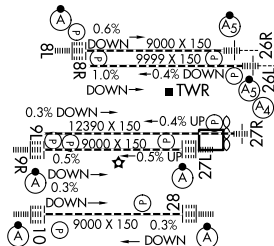

HIRL all Rwy's
TDZ/CL Rwy's 8L, 9R,
10, 26R, 27L and 28

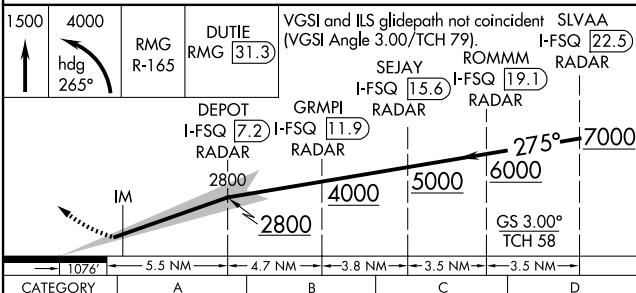

S-ILS 27L RA 127/12 100 DA 1099

**CATEGORY II ILS- SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED**

ILS PRM RWY 27L (CAT II) (CLOSE PARALLEL)