



25219

ILS RWY 27L (CAT II)
HARTSFIELD/JACKSON ATLANTA INTL (ATL)


MISSED APPROACH: Climb to 1500 then climbing left turn to 4000 on heading 265° and RMG VORTAC R-165 to DUTIE/RMG 31.3 DME/RADAR and hold.



CLNC DEL 118-1	CPDLC
-----------------------------	-------

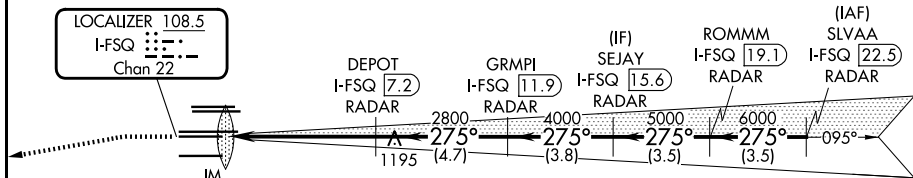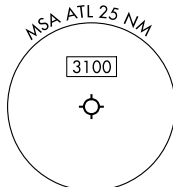

1500
↑
4000
hdg
265°
RMG
R-165
DUTIE
RMG
31.3
VGSI and ILS glidepath not coincident
(VGSI Angle 3.00/TCH 79)
SLVAA
ROMMM I-FSQ 22.5
SEJAY I-FSQ 19.1
RADAR
DEPOT I-FSQ 7.2
GRMPI I-FSQ 11.9
RADAR
IM 1121
2800
4000
5000
6000
275°
7000
GS 3.00°
TCH 58
1026'
5.5 NM
4.7 NM
3.8 NM
3.5 NM
3.5 NM

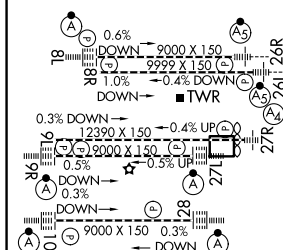

CATEGORY II ILS- SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED

33°38'N-84°26'W

HARTSFIELD/JACKSON ATLANTA INTL (ATL)
W ILS RWY 27L (CAT II)