

(SITTH.SITTH3) 25331


# SITTH THREE ARRIVAL (RNAV)

AL-26 (FAA)

HARTSFIELD/JACKSON ATLANTA INTL (ATL)

ATLANTA, GEORGIA

SE-4, 19 MAR 2026 to 16 APR 2026

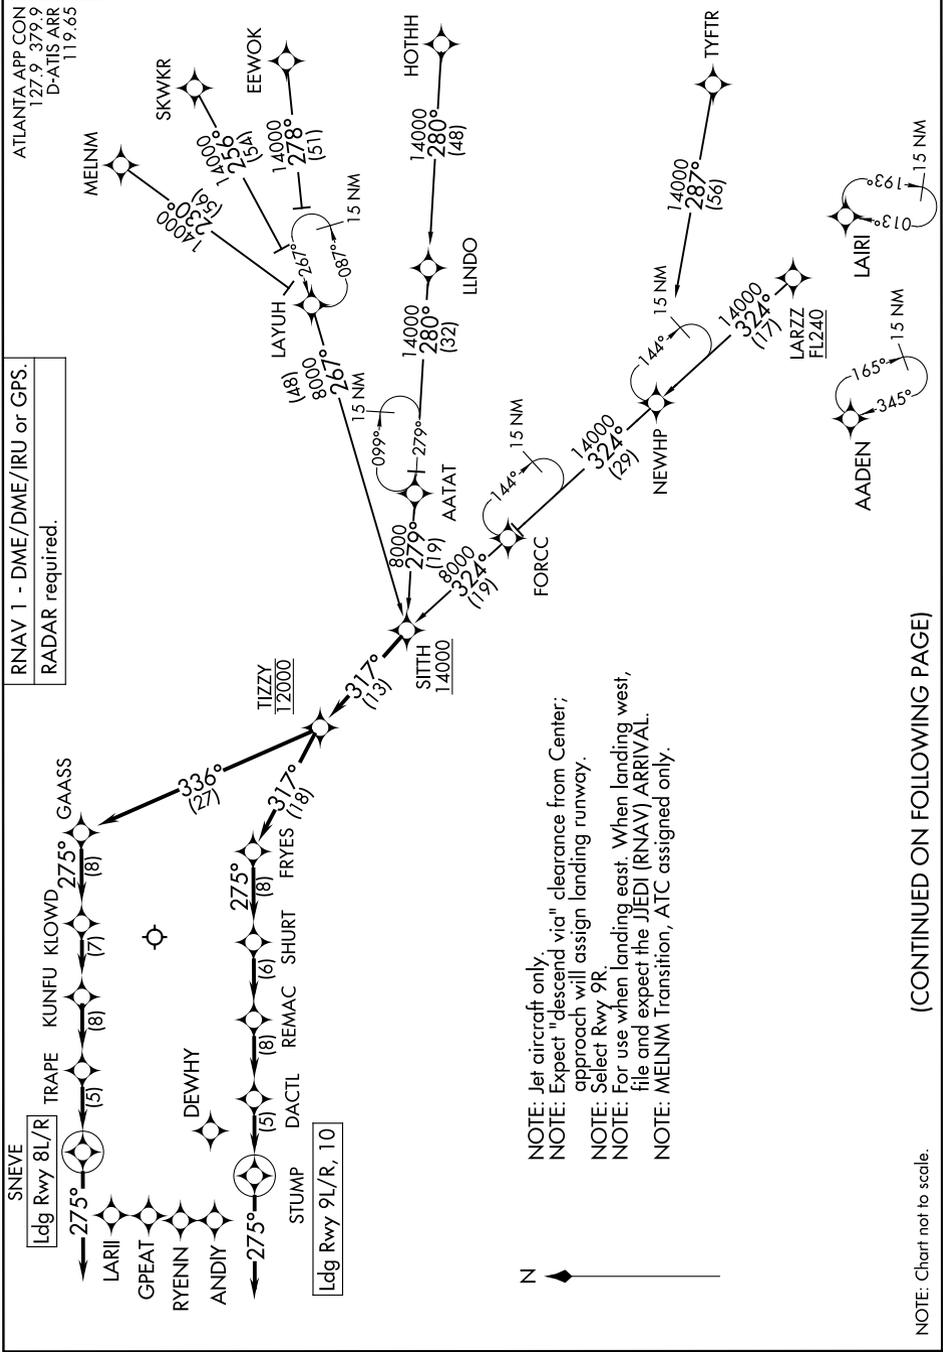

(CONTINUED ON FOLLOWING PAGE)

SE-4, 19 MAR 2026 to 16 APR 2026

SITTH THREE ARRIVAL (RNAV)  
(SITTH.SITTH3) 27NOV25

ATLANTA, GEORGIA  
HARTSFIELD/JACKSON ATLANTA INTL (ATL)

ARRIVAL ROUTE DESCRIPTION

EEWOK TRANSITION (EEWOK.SITTH3)

HOTHH TRANSITION (HOTHH.SITTH3)

LARZZ TRANSITION (LARZZ.SITTH3)

LAYUH TRANSITION (LAYUH.SITTH3)

MELNM TRANSITION (MELNM.SITTH3)

SKWKR TRANSITION (SKWKR.SITTH3)

TYFTR TRANSITION (TYFTR.SITTH3)

From SITTH on track 317° to cross TIZZY at 12000.

LANDING RUNWAYS 8L/R: From TIZZY on track 336° to GAASS, then on track 275° to KLOWD, then on track 275° to KUNFU, then on track 275° to TRAPE, then on track 275° to SNEVE, then on track 275°. Expect RADAR vectors to final approach course.

LANDING RUNWAYS 9L/R, 10: From TIZZY on track 317° to FRYES, then on track 275° to SHURT, then on track 275° to REMAC, then on track 275° to DACTL, then on track 275° to STUMP, then on track 275°. Expect RADAR vectors to final approach course.

LOST COMMUNICATIONS

ASSIGNED RUNWAY 10 OR RUNWAY NOT ASSIGNED: Cross SITTH at or above 14000; cross TIZZY at 12000; cross FRYES at 12000; cross REMAC at or above 7000; cross STUMP at 4000; after STUMP turn right direct DEWHY and proceed on the ILS or RNAV RWY 10 approach.

ASSIGNED RUNWAY 9L: Cross SITTH at or above 14000; cross TIZZY at 12000; cross FRYES at 12000; cross REMAC at or above 7000; cross STUMP at 4000; after STUMP turn right direct RYENN and proceed on the ILS or RNAV RWY 9L approach.

ASSIGNED RUNWAY 9R: Cross SITTH at or above 14000; cross TIZZY at 12000; cross FRYES at 12000; cross REMAC at or above 7000; cross STUMP at 4000; after STUMP turn right direct ANDIY and proceed on the ILS or RNAV RWY 9R approach.

ASSIGNED RUNWAY 8L: Cross SITTH at or above 14000; cross TIZZY at 12000; cross GAASS at 12000, cross KUNFU at or above 7000; cross SNEVE at 5000; after SNEVE turn left direct LARII and proceed on the ILS or RNAV RWY 8L approach.

ASSIGNED RUNWAY 8R: Cross SITTH at or above 14000; cross TIZZY at 12000; cross GAASS at 12000, cross KUNFU at or above 7000; cross SNEVE at 5000; after SNEVE turn left direct GPEAT and proceed on the ILS or RNAV RWY 8R approach.