


ILS or LOC RWY 36R
CHARLOTTE/DOUGLAS INTL (CLT)

MISSED APPROACH: Climb to 1320 then climbing right turn to 4000 on CLT VOR/DME R-093 to LOCAS INT/24.9 DME and hold.

RADAR REQUIRED

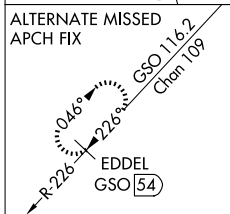

1320 ↑	4000	CLT R-093	LOCAS △	VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 74).		HEKAM JENDA I-BQC <u>17.9</u> I-BQC <u>14.8</u> RADAR
* LOC only.						
CATEGORY	A		B		C	D
S-ILS 36R	927/18					200 (200-½)
S-LOC 36R	1120/24 393 (400-½)			1120/35 393 (400-¾)		
CIRCLING	1380-1 632 (700-1)			1500-2¼ 752 (800-2¼)		1500-2½ 752 (800-2½)

SE-2, 02 OCT 2025 to 30 OCT 2025