

LOC I-MGM	APP CRS	Rwy Ldg	9020
109.9	097°	TDZE	219
		Apt Elev	232

ILS Z or LOC Z RWY 10
MONTGOMERY RGNL (DANNELLY FLD) (MGM)

RADAR or DME or ADF required.



⚠ Circling NA for Cat E north of Rwy 10-28. For inop ALS, increase S-ILS 10** Cat E visibility to RVR 4000, and increase S-LOC 10 Cat E visibility to 1½ SM. **RVR 1800 authorized with the use of FD or AP or HUD to DA.


MALSR



MISSED APPROACH: Climb to 700 then climbing right turn to 3000 direct MGM VORTAC and hold, continue climb-in-hold to 3000 (TACAN aircraft continue climb to 3500 on MGM VORTAC R-126 to SHADY/MGM 15 DME and hold SE, RT, 306° inbound).

ATIS 120.675	MONTGOMERY APP CON★ 124.0 363.025	DANNELLY TOWER★ 119.7 (CTAF) 360.85	GND CON 121.7 348.6	UNICOM 122.95
-----------------	--------------------------------------	--	------------------------	------------------

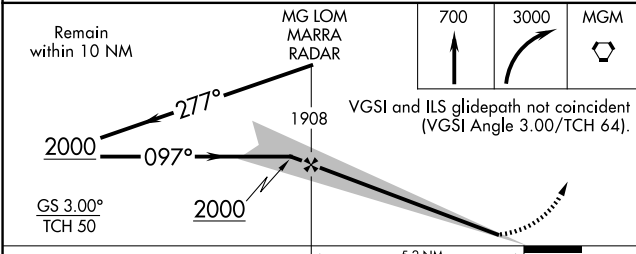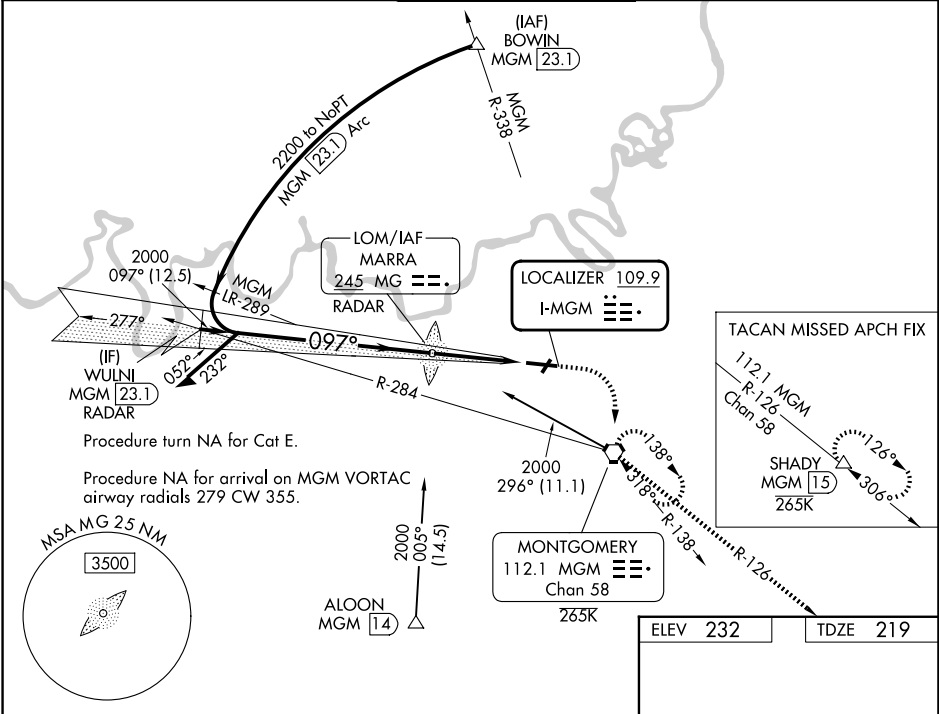

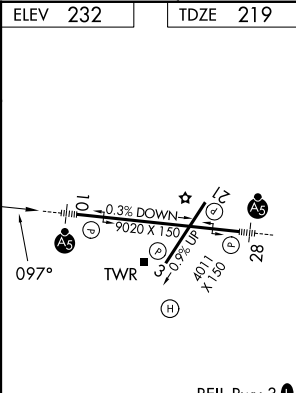ELEV	232	TDZE	219		
					
REIL Rwy 3 1					
MIRL Rwy 3-21					
HIRL Rwy 10-28					
FAF to MAP 5.2 NM					
Knots	60	90	120	150	180
Min:Sec	5:12	3:28	2:36	2:05	1:44

SE-4, 02 OCT 2025 to 30 OCT 2025

SE-4, 02 OCT 2025 to 30 OCT 2025