

HILO, HAWAII

AL-756 (FAA)

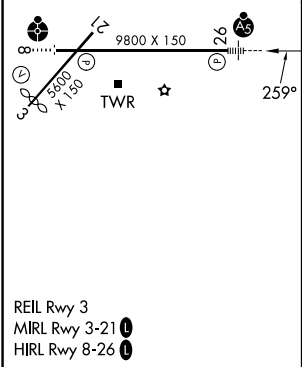
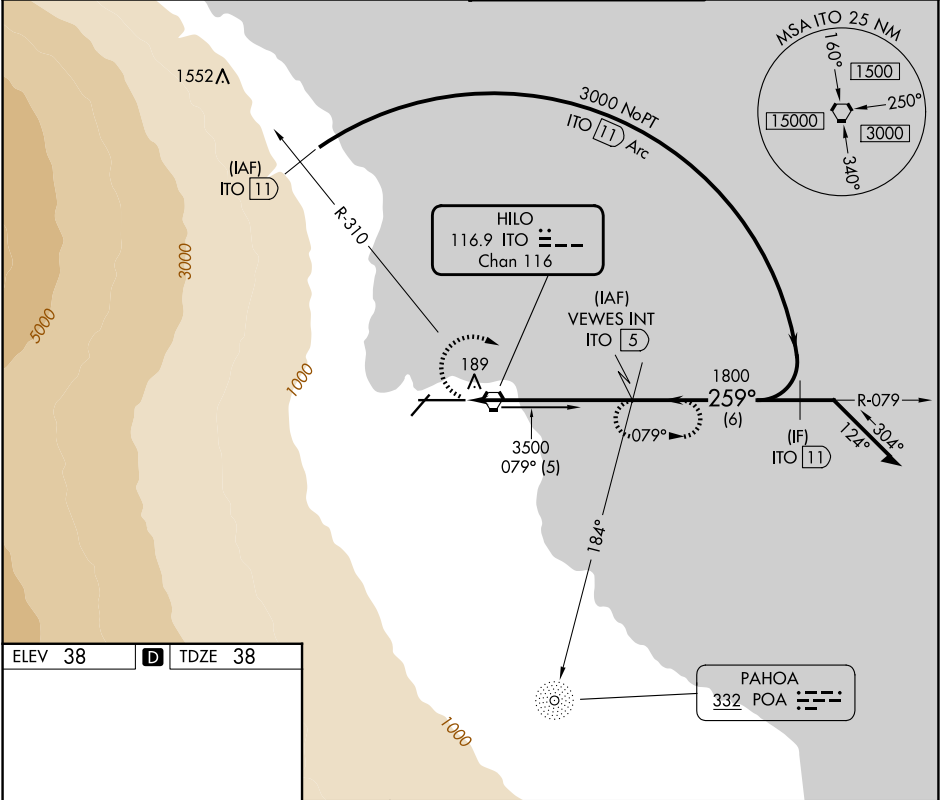
25275






VORTAC ITO 116.9 Chan 116	APP CRS 259°	Rwy Ldg 9800 TDZE 38 Apt Elev 38
---	------------------------	---

VOR/DME or TACAN RWY 26
HILO INTL (ITO) (PHTO)

 For inop ALS, increase S-26 Cat A/B visibility to 1 SM and Cat D to 1 1/4 SM. Circling NA south of Rwy 8-26. Helicopter visibility reduction below 3/4 SM NA.	 MALSR	MISSED APPROACH: Climbing right turn to 3000 on ITO VORTAC R-079 to VEWES/5 DME and hold.
---	-----------	---

ATIS 126.4	HILO APP CON ★ 119.7 269.2	HILO TOWER ★ 118.1(CTAF) 263.1	GND CON 121.9
----------------------	--------------------------------------	--	-------------------------



3000 	VEWES INT	VEWES INT ITO 5 		
	ITO VORTAC ITO 1 ITO 0.2 			Remain within 10 NM
				
CATEGORY	A	B	C	D
S-26	460-3/4 422 (500-3/4)			460-1 422 (500-1)
CIRCLING	500-1 462 (500-1)	540-1 502 (600-1)	840-2 1/4 802 (900-2 1/4)	1320-3 1282 (1300-3)

HILO, HAWAII
Amdt 5E 16JUL20

19°43'N-155°03'W

HILO INTL (ITO) (PHTO)

VOR/DME or TACAN RWY 26

PAC, 27 NOV 2025 to 22 JAN 2026

PAC, 27 NOV 2025 to 22 JAN 2026