


WAAS CH 50244 W31A	APP CRS 300°	Rwy Ldg TDZE Apt Elev	8500 429 476
--	------------------------	-----------------------------	---

RNAV (GPS) Z RWY 31L
PALM SPRINGS INTL (PSP)

RNP APCH-GPS.		MISSED APPROACH: Climb to 900 then climbing right turn to 4000 direct TANFY and track 107° to BANPE and track 144° to TRM VORTAC and hold. *Missed approach requires minimum climb of 355 feet per NM to 2100.	
Circling NA southwest of Rwy 13R-31L.			
ATIS 124.65	SOCAL APP CON 126.7 370.95 135.275 251.1	PALM SPRINGS TOWER * 119.7 (CTAF) 377.05	GND CON 121.9
		UNICOM 122.95	

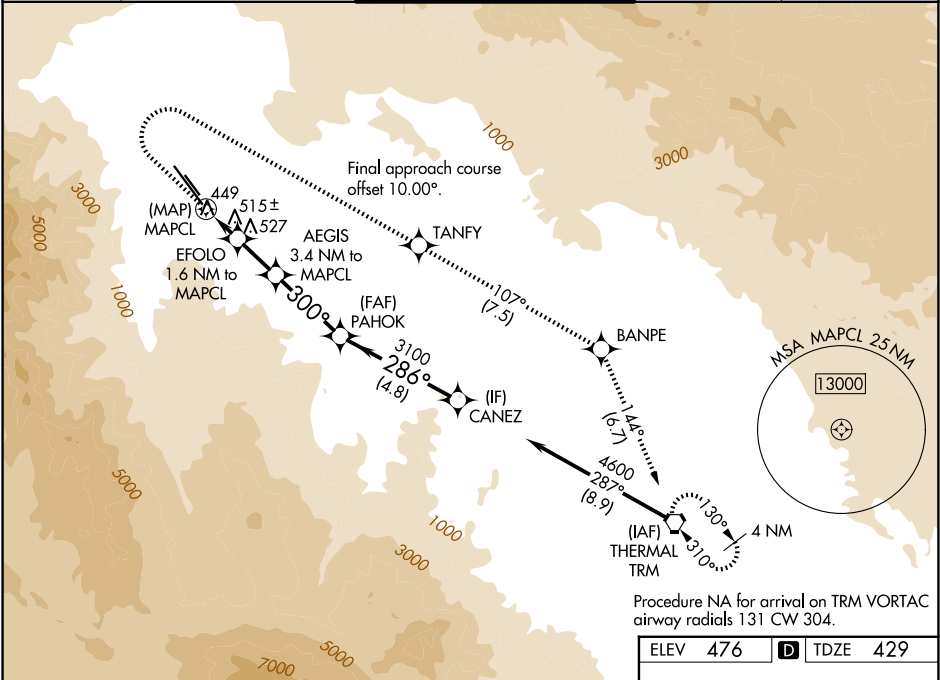

900 ↑	4000 ↗	TANFY ✧	tr 107°	BANPE ✧	tr 144°	TRM ⬡
VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 55).						PAHOK
EFOLO 1.6 NM to MAPCL						AEGIS 3.4 NM to MAPCL
MAPCL						300°
1220						3100
0.5 1.6 NM 1.9 NM 3.2 NM 4.8 NM						286°
CATEGORY						CANEZ
LP MDA		700-1 271 (300-1)		780-1 351 (400-1)		1320-2½ 891 (900-2½)
RNAV MDA*		780-1 351 (400-1)				
RNAV MDA		920-1 491 (500-1)		1180-1¼ 751 (800-1¼)		1440-3 1011 (1000-3)
CIRCLING		920-1 444 (500-1)		1180-1¼ 704 (800-1¼)		1440-3 1760-3 964 (1000-3) 1284 (1300-3)

