
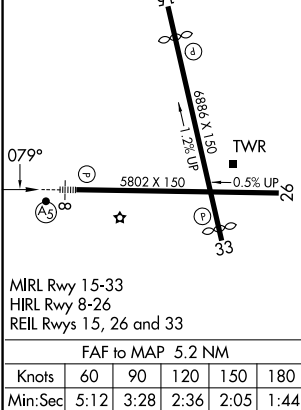


LOC I-BUR 109.5	APP CRS 079°	Rwy Ldg TDZE Apt Elev	5801 727 778
---------------------------	------------------------	-----------------------------	---

ILS Z or LOC Z RWY 8
HOLLYWOOD BURBANK (BUR)

From MIKEI: RNAV 1-GPS required.	MALSR 	MISSED APPROACH: Climb to 1300 then climbing right turn to 4600 on heading 210° and VTU VOR/DME R-086 to VTU VOR/DME and hold. # Missed approach requires a minimum climb of 340 feet per NM to 2520 (if unable to meet climb gradient, see ILS Y or LOC Y RWY 8).
----------------------------------	--	---

D-ATIS 134.5	SOCAL APP CON 120.4 360.6 (N) 134.2 338.2 (W)	BURBANK TOWER 118.7 254.3	GND CON 123.9 348.6
------------------------	---	-------------------------------------	-------------------------------

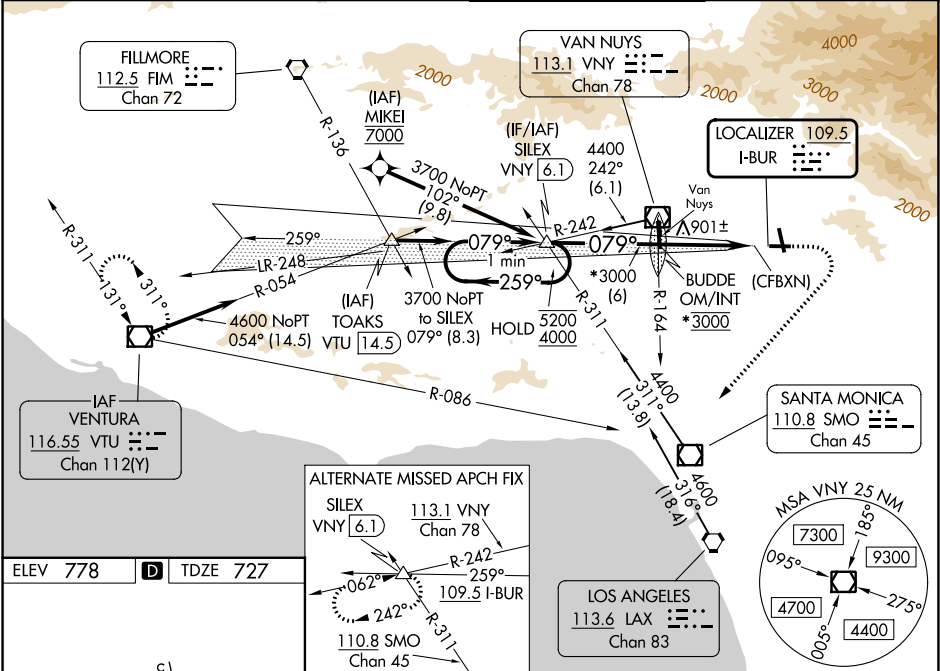

One Minute Holding Pattern	SILEX VNY (6.1)	BUDE OM/INT	VTU R-086	VTU
5200 ← 259°	4000 → 079°	3700 → 079°	2753	* LOC only
GS 3.00°	TCH 60	3000	* 3000	(CFBXN)
6 NM	5.2 NM	0.9		
CATEGORY	A	B	C	D
S-ILS 8 #		1075/50	348 (300-1)	
S-LOC 8 #		1160/50	433 (400-1)	
CIRCLING	1280-1 1/8 502 (600-1 1/8)	1640-1 1/4 862 (900-1 1/4)	2240-3 1462 (1500-3)	2320-3 1542 (1600-3)