


LOC/DME I-TUC 111.7 Chan 54	APP CRS 344°	Rwy Ldg TDZE Apt Elev	34C 9426 11901 387 372 432 432	34R
---	------------------------	-----------------------------	--	-----

ILS or LOC RWY 34C
SEATTLE-TACOMA INTL (SEA)

DME or RADAR required. From SONDR: RNAV 1-GPS required.	MALSR Rwy 34C/R	MISSED APPROACH: Climb on heading 345° and outbound on SEA VORTAC R-341 to cross COYLA/SEA 4.7 DME/RADAR at or above 3000 then climb to 5000 on SEA VORTAC R-341 to MGNM/SEA 12.7 DME/RADAR and hold, continue climb-in-hold to 5000.
Inop table does not apply to ALS Rwy 34R. Simultaneous approach authorized with Rwy 34L.		

D-ATIS 118.0	SEATTLE APP CON 133.65 273.45	SEATTLE TOWER 119.9 239.3 (16L, 16C, 34C, 34R) 120.95 239.3 (16R, 34L)	GND CON 121.7
------------------------	---	--	-------------------------

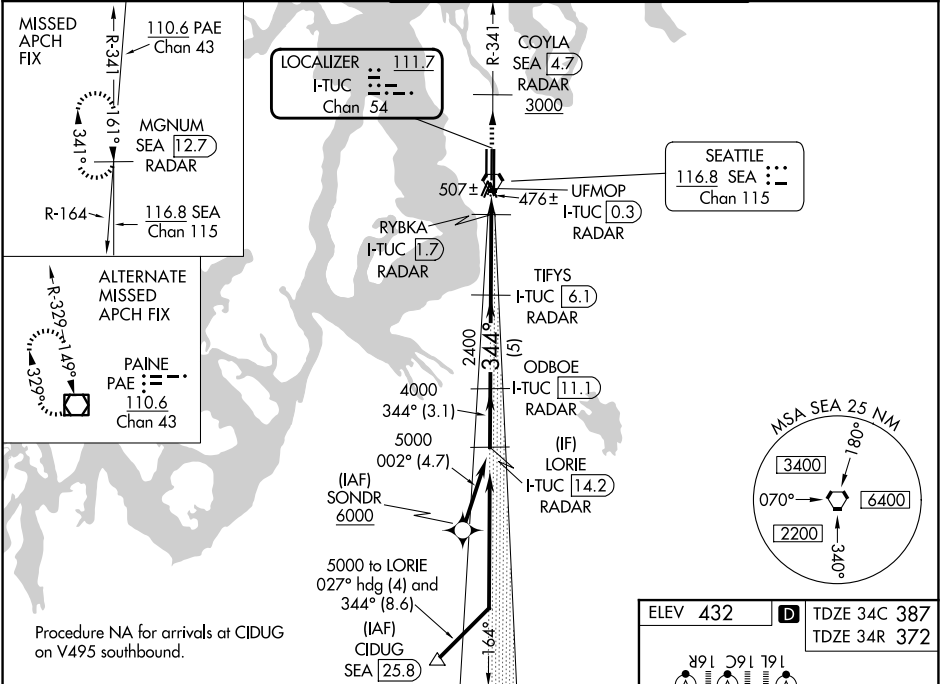

VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 73).				
LORIE I-TUC 14.2 RADAR	ODBOE I-TUC 11.1 RADAR	TIFYS I-TUC 6.1 RADAR	RYBKA I-TUC 1.7 RADAR	UFMOP I-TUC 0.3 RADAR
5000	4000	2400	1000	
GS 3.00° TCH 56				
3.1 NM	5 NM	4.3 NM	0.9 NM	0.5 NM
CATEGORY	A	B	C	D
S-ILS 34C	604/24		217 (200-½)	
S-LOC 34C	760/24	373 (400-½)	760/35	373 (400-¾)
SIDESTEP 34R	760/50	388 (400-1)	760/60	388 (400-1¼)
CIRCLING	1000-1	568 (600-1)	1000-1½ 568 (600-1½)	1000-2 568 (600-2)

