

WAAS CH 77710 W34B	APP CRS 344°	Rwy Ldg 9426 TDZE 387 Apt Elev 432
--	------------------------	---

RNAV (GPS) Y RWY 34C
SEATTLE-TACOMA INTL (SEA)

RNP APCH.


T Simultaneous approach authorized with Rwy 34L. LNAV procedure NA during simultaneous operations. Use of FD or AP providing RNAV track guidance required during simultaneous operations. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -6°C (22°F) or above 54°C (130°F).

MALSR



MISSED APPROACH:
Climb to 5000 direct
MGNUM and hold,
continue climb-in-hold
to 5000.

D-ATIS 118.0	SEATTLE APP CON 133.65 273.45	SEATTLE TOWER 119.9 239.3 (16L, 16C, 34C, 34R) 120.95 239.3 (16R, 34L)	GND CON 121.7
------------------------	---	--	-------------------------

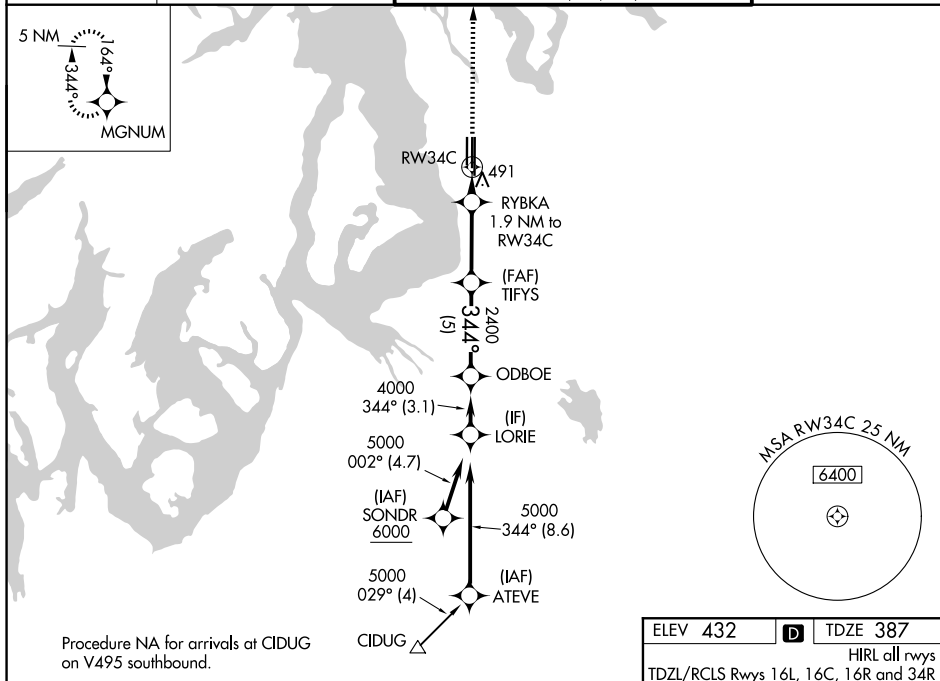


NW-1, 03 SEP 2026 to 01 OCT 2026

NW-1, 03 SEP 2026 to 01 OCT 2026

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 73).

CATEGORY	A	B	C	D
LPV DA	610/24	223 (200-½)		
LNAV/ VNAV DA	839/50	452 (500-1)		
LNAV MDA	880/24	493 (500-½)	880/55	493 (500-1)
CIRCLING	1000-1	568 (600-1)	1000-1½ 568 (600-1½)	1000-2 568 (600-2)

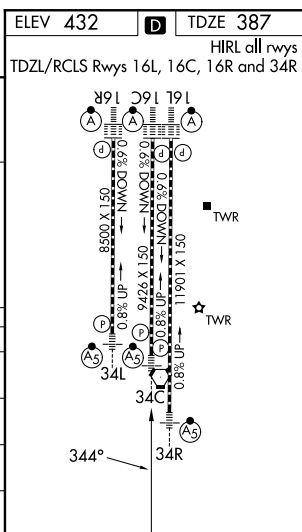

SEATTLE, WASHINGTON

Amdt 2D 21JUN18

47°27'N-122°19'W

SEATTLE-TACOMA INTL (SEA)

RNAV (GPS) Y RWY 34C